



PRODUCT INFO

Base clamps BK of die-cast aluminum or precision-cast stainless steel have a slitted clamping point machined by cutting methods.

The base flange with four bores serves as an interface or for fastening the clamp to the place of use.


The bore at the clamping point is arranged perpendicular to the face of the flange. It receives typically available rods and tubes with full surface contact over the entire cross-section of the bore.

At the screw point, a hex socket cap screw reduces the bore cross-section for clamping.

RoHS-compliant product





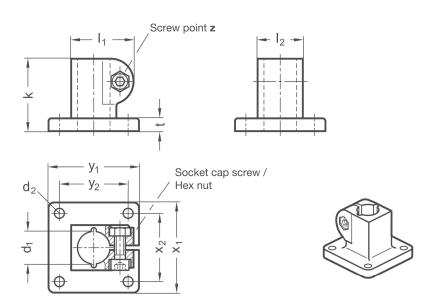



Clamping p Bore d 1	Stainless steel	d_2	Clamping length k	I ₄		t	X ₁	X ₂	y ₁	У2	Hex socket cap screw
B 10	-	5,5	40	34,5	25	7	50	38	50	38	M 6-20
B 12	B 12	5,5	40	34,5	25	7	50	38	50	38	M 6-20
B 14	B 14	5,5	40	34,5	25	7	50	38	50	38	M 6-20
B 15	B 15	5,5	40	34,5	25	7	50	38	50	38	M 6-20
B 16	B 16	5,5	40	34,5	25	7	50	38	50	38	M 6-20
B 18	B 18	5,5	40	34,5	25	7	50	38	50	38	M 6-20
-	B 20	5,5	40	34,5	25	7	50	38	50	38	M 6-20

Screw point

Z

Hex socket cap screw steel, zinc-plated DIN 912-8.8 and lock nut steel DIN 985-8, zinc-plated (only for aluminum clamps)
--

2 Hex socket cap screw stainless steel DIN 912-A2-70 and lock nut stainless steel DIN 985-A2, glide coating

Surface / material

0

2	Aluminum, textured powder-coated, Black RAL 9005				
8	Aluminum, blasted, matt				
ED	Stainless steel, blasted, matt				

ORDER KEY Base clamp Clamping point Screw point Surface / material

ON REQUEST

- Clamping point with special diameter
- Screw point with hex head screw
- Surface ball-burnished, anodized or powder-coated in other RAL colors